


LEGEND:

- △ O.D.O.T. Conc. R/W Monu.
@ Sta. 1156+03.30, 81.25'
- △_B O.D.O.T. Conc. R/W Monu.
@ Sta. 1171+03.47, 78.36
- △_C O.D.O.T. Conc. Monu. @ SW
Corner SE 1/4 Sec. 33, Union Twp.
- △_D O.D.O.T. Conc. Monu. @ NE
Corner NW 1/4 Sec. 4, Clay Twp.
- _E ~ RR Spike Set
- _F ~ RR Spike Found
- △_G ~ Monu. Box @ NE Corner
NW 1/4 Sec. 4, Clay Twp.
- _H ~ 3" ∅ Steel Corner Post
Found.

LOCATION MAP

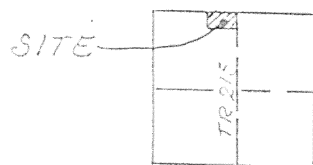

SECTION 4
Clay Township
T-6-S, R-7-E,
Auglaize County
Ohio

Signature by a representative of the County Health Dept.
denotes compliance with Health Regulations.
Signed: _____ Date _____

Signature by a representative of the Auglaize County Regional
Planning Commission denotes approval of this plat.
Signed: _____ Date _____

Signature by a representative of City with 3 mile limit juris-
diction or Twp. Trustees or Village with zoning jurisdiction
denotes approval of this plat. Signed: _____
for political S. D. of: _____ Date _____

Signature by a representative of the County Engineer's Dept.
denotes that this plat meets tax map plat requirements.
Signed: _____ Date _____

KUCK and MORRISEY, INC.
CONSULTING ENGINEERS & SURVEYORS
LIMA, OHIO 45805
TELEPHONE 228-1735 • AREA CODE 419
2807 CHAPEL HILL DRIVE

Client Mr. Waldo MERTZ
County Auglaize Twp. Clay Sec. 4
Drawn by RDM Scale 1"=1200' Drwg. No. _____
Checked by rdm Date 8/19/94
Sheet 1 of 2 J-647 (T-6-S; R-7-E)



Scale: _____

DESCRIPTION

Being a parcel of land situate in the Northwest quarter of Section 4, T-6-S, R-7-E, Clay Township, Auglaize County, Ohio and more particularly described as follows:

BEGINNING at a ODOT concrete monument found at the northeast corner of said Northwest quarter of said Section 4; thence S $00^{\circ}24'53''$ W with the east line of said Northwest quarter, 605.00 feet to a railroad spike set; thence S $89^{\circ}54'08''$ W (passing through a 5/8 inch rebar set at 16.50 feet), 956.65 feet to a three inch diameter steel corner post found; thence N $00^{\circ}09'41''$ W with an existing fence (passing through a three inch diameter steel corner post found at 574.62 feet), 604.65 feet to a point on the north line of said Northwest quarter of said Section 4; thence N $89^{\circ}50'10''$ E with said north line, 65.87 feet to a point; thence N $89^{\circ}46'25''$ E continuing with said north line, 707.71 feet to a ODOT concrete monument found at the southeast corner of the Southwest quarter of Section 33, Union Township, Auglaize County; thence S $89^{\circ}41'32''$ E continuing with said north line, 189.15 feet to the PLACE OF BEGINNING containing 13.340 acres more or less and subject to all highway and other legal easements of record.

I hereby certify the accompanying map and survey which it represents to be correct to the best of my knowledge and belief. All rebar set and called for are topped with a plastic Peramark cap stamped: KUCK & MORRISEY L.S. 6470.

Date: 8/19/94

Richard D. Morrisey
Richard D. Morrisey, L.S. 6470
Kuck and Morrisey, Inc.



Signature by a representative of the County Health Dept. denotes compliance with Health Regulations.

Signed: _____ Date: _____

Signature by a representative of the Auglaize County Regional Planning Commission denotes approval of this plat.

Signed: _____ Date: _____

Signature by a representative of City with 3 mile limit jurisdiction or Twp. Trustees or Village with zoning jurisdiction denotes approval of this plat. Signed: _____

for political S. D. of: _____ Date: _____

Signature by a representative of the County Engineer's Dept. denotes that this plat meets tax map plat requirements.

Signed: _____ Date: _____

KUCK and MORRISEY, INC.

CONSULTING ENGINEERS & SURVEYORS
LIMA, OHIO 45805

TELEPHONE 228-1735 - AREA CODE 419
2807 CHAPEL HILL DRIVE

Client Mr. Waldo MERTZ

County Auglaize Twp. Clay Sec. 4

Drawn by EDM Scale _____ Drwg. No. _____

Checked by rdm Date 8/19/94

Sheet 2 of 2 J-648 (T-6-S; R-7-E)