

NW Corner
NW 1/4 Sec. 20

I hereby certify the accompanying map and survey which it represents to be correct to the best of my knowledge and belief. All rebar set and called for are topped with a plastic Peramark cap stamped: KUCK & MORRISEY L.S. 6470.

Date: 6/30/89

Richard D. Morrissey
Richard D. Morrissey, L.S. 6470
Kuck and Morrissey, Inc.



LEGEND:

- A Δ ~ Monu. Box found
- B ○ ~ PK nail set
- C ○ ~ RR Spike found
- D ○ ~ 5/8" Rebar set 30' off E
- E ○ ~ 5/8" Rebar set


DESCRIPTION

Being a parcel of land situate in the southwest quarter of the Northwest quarter of Section 20, T-5-S, R-8-E, Wayne Township, Auglaize County, Ohio and lying partially within the corporation limits of the Village of Waynesfield, Ohio and more particularly described as follows:

Commencing at at monument box found at the southwest corner of said Northwest quarter; thence N 00°00'00" E (assumed bearing) with the west line of the southwest quarter of said Northwest quarter of said Section 20 (also the centerline of Waynesfield Road - C.R. 261), 1085.39 feet to a PK nail set and the PLACE OF BEGINNING; thence continuing N 00°00'00" E with said west line and centerline, 230.00 feet to a railroad spike found at the northwest corner of said southwest quarter of said Northwest quarter; thence N 88°59'35" E with the north line of said southwest quarter of said Northwest quarter (passing through a 5/8 inch rebar set at 30.00 feet), 210.00 feet to a 5/8 inch rebar set; thence S 00°00'00" W, 230.00 feet to a 5/8 inch rebar set; thence S 88°59'35" W (passing through a 5/8 inch rebar set at 180.00 feet), 210.00 feet to the PLACE OF BEGINNING containing 1.109 acres more or less and subject to all highways and other legal easements of record.

Monu. Box @
SW Corner
NW 1/4 Sec. 20

E Waynesfield Rd. (50' R/W)
W-Line SW 1/4 NW 1/4 Sec. 20

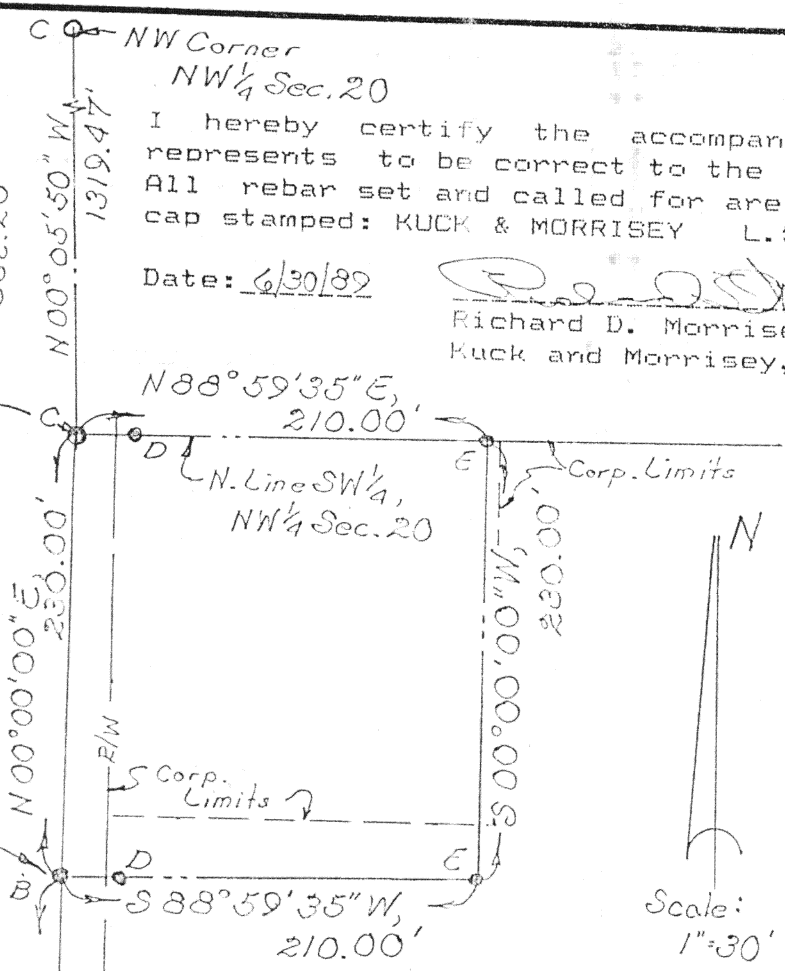

Scale:
1"=30'

Signature by a representative of the County Health Dept. denotes compliance with Health Regulations.
Signed: _____ Date: _____

Signature by a representative of the Auglaize County Regional Planning Commission denotes approval of this plat.
Signed: _____ Date: _____

Signature by a representative of City with 3 mile limit jurisdiction or Twp. Trustees or Village with zoning jurisdiction denotes approval of this plat. Signed: _____ Date: _____
for political S. D. of: _____

Signature by a representative of the County Engineer's Dept. denotes that this plat meets tax map plat requirements.
Signed: _____ Date: _____

KUCK AND MORRISEY, INC.
CONSULTING ENGINEERS & SURVEYORS
2807 CHAPEL HILL DRIVE
LIMA, OHIO 45805 - 228-1735

Client Mr. & Mrs. Robert Spillman
County Auglaize Twp. Wayne Sec. 20
Drawn by RDM Scale _____ Drwg. No. _____
Checked by RDM Date 6/30/89
Sheet 1 of 1 J-102 (T-5-S; R-8-E)