

Florence Green
OR 270 P. 919

Boundary Survey
of parcel No.
305-036-022-00
as described in
OR 285 P. 949

in NE $\frac{1}{4}$ Sec.
T18-P6E-10

Duchouquet
Township,
Auglaize Co.,
Ohio

Kenneth Lauf OR 300 Pg.

50°07'07"W

410.00'

25.00'

P.O.B.

1.028 Ac. incl. 0.072 Ac. of 1 ad R/W

125.00'

N0°07'07"E

242.00'

N89°16'16"W
40.00'

168.05'

24.93'

N0°07'07"E

WZOG Broadcasting Co.
OR 18 Pg. 516 & 522

N

NE $\frac{1}{4}$

500.00'

National Rd., Assumed Bearing: N89°15'00"E

- Railroad Spike Found
- = PK Nail Found
- = $\frac{3}{4}$ " Iron Pipe Found
- = $\frac{1}{2}$ " Rerod Found
- △ = $\frac{1}{2}$ " Rerod w/Permamark Cap Set

George E. Woolley



ACCU-TRACE LAND SURVEYS INC.

George E. Woolley, Registered Land Surveyor No. 5772
3083 Fort Amanda Road, Lima, Ohio 45805 • (419) 999-4455

CLIENT NAME

David Green

SURVEYED BY

AW

DATE

5-12-98

DRAWN BY

AW

DATE

5-14-98

SCALE

1" = 50'

PAGE

1

OF

2

PAGES

N-560



ACCU-TRACE LAND SURVEYS, INC.
3083 FORT AMANDA ROAD
P.O. BOX 11
LIMA, OHIO 45802
(419) 999-4455 or 999-6512

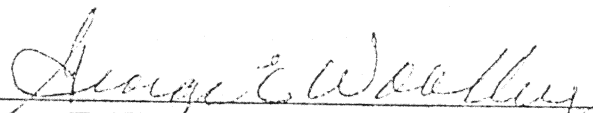


David Green
Page 2 of 2 pages
May 14, 1998

The following described tract of land is parcel number B05-036-022-00 as described in Deed Vol. OR 285 Page 949 and is situated in the northeast Quarter of Section thirty-six Township 4 South, Range 6 East, Duchouquet Township, Auglaize County, Ohio.

Commencing at the PK nail found in the west line of said quarter in the centerline of National Road; thence North eighty-nine degrees fifteen minutes zero seconds East (N 89° 15' 00" E), in the centerline of said road, assumed bearing, five hundred and zero hundredths (500.00) feet to a PK nail found at THE PLACE OF BEGINNING; thence North eighty-nine degrees fifteen minutes zero seconds East (N 89° 15' 00" E) one hundred twenty-five and zero hundredths (125.00) feet to a railroad spike found; thence North zero degrees seven minutes seven seconds East (N 0° 07' 07" E) twenty-four and ninety-three hundredths (24.93) feet to a 3/4" iron pipe found; thence North zero degrees seven minutes seven seconds East (N 0° 07' 07" E) one hundred sixty-eight and five hundredths (168.05) feet to a 1/2 inch re-rod found; thence North eighty-nine degrees sixteen minutes twenty-six seconds West (N 89° 16' 16" W) thirty-nine and eighty-nine hundredths (40.00) feet to a 3/4" iron pipe found; thence North zero degrees seven minutes seven seconds East (N 0° 07' 07" E) two hundred forty-two and zero hundredths (242.00) feet to a 1/2 inch re-rod set; thence South eighty-eight degrees thirty-four minutes eighteen seconds West (S 88° 34' 18" W) eighty-five and two hundredths (85.02) feet to a 1/2 inch re-rod set; thence South zero degrees seven minutes seven seconds West (S 0° 07' 07" W) four hundred ten and zero hundredths (410.00) feet to a 3/4" iron pipe found; thence South zero degrees seven minutes seven seconds West (S 0° 07' 07" W) twenty-five and zero hundredths (25.00) feet to the place of beginning containing one and twenty-eight thousandths (1.028) acres, more or less, subject to legal highways and all easements and restrictions of record.

All 1/2" re-rods set, as called for above, are thirty (30) inches long, are set flush or below the surface, and are topped with a red plastic Permamark® cap stamped "LS 5772". This description and accompanying plat represents a boundary survey completed under my supervision on May 12, 1998 and all markers called for above are in place.


George E. Woolley, Reg. Surveyor No. 5772