


LEGEND:

- ⊙ A 1" Iron pin found in Monu. Box at SW corner SE 1/4 Sec 20
- ⊙ B Capped 5/8" rebar set
- ⊙ C Capped 5/8" rebar set 25' north of South line
- ⊙ D PK nail and shiner set
- ⊙ E Iron pipe found at NW corner SE 1/4 Sec 20
- ⊙ F PK nail previously found at E 1/4 post Sec. 20
- ⊙ G Chiseled "x" in Monu. Box at SE corner SE 1/4 Sec 20
- ⊙ H PK nail and shiner set during previous surveys

This survey is a summary of field surveys completed by Kuck and Morrissey Inc. in June '95, May '98, Aug. '07 and Sept. '15.

Richard D. Morrissey

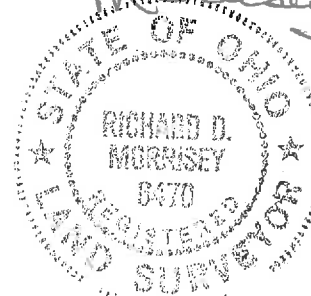

E. Line SE 1/4 Sec 20

Signature by a representative of the County Health Dept. denotes compliance with Health Regulations.
Signed: _____ Date: _____

Signature by a representative of the Auglaize County Regional Planning Commission denotes approval of this plat.
Signed: _____ Date: _____

Signature by a representative of City with 3 mile limit jurisdiction or Twp. Trustees or Village with zoning jurisdiction denotes approval of this plat. Signed: _____
for political S. D. of: _____ Date: _____

Signature by a representative of the County Engineer's Dept. denotes that this plat meets tax map plat requirements.
Signed: _____ Date: _____

KUCK and MORRISSEY, LLC

CONSULTING ENGINEERS & SURVEYORS

LIMA, OHIO 45805

TELEPHONE & FAX 419-236-1735

Client Mary WILKINS
County Auglaize Twp. Logan Sec. 20
Drawn by RDM Scale _____ Drwg. No. _____
Checked by RDM Date 10/24/15

DESCRIPTION – PARCEL No. 1

Being a parcel of land situate in the west half of the Southeast quarter of Section 20, T-4-S, R-5-E, Logan Township, Auglaize County, Ohio and more particularly described as follows:

BEGINNING at a one inch iron pin found in a monument box found at the southwest corner of said Southeast quarter of said Section 20; thence N 00°56'30" E with the west line of said Southeast quarter, 440.00 feet to a capped 5/8 inch rebar set; thence S 88°54'53" E, 225.00 feet to a capped 5/8 inch rebar set; thence S 00°56'30" W (passing through a capped 5/8 inch rebar set at 415.00 feet), 440.00 feet to a PK nail and shiner set on the south line of said Southeast quarter; thence N 88°54'53" W with said south line (also the centerline of Burnfield Road), 225.00 feet to the **PLACE OF BEGINNING** containing 2.273 acres more or less and subject to all highway and other legal easements of record. Road right-of-way occupies 0.103 acre. Deed reference: D.V. 263, Pg. 918.

Surveyed by: **KUCK and MORRISEY, LLC.**, Richard D. Morrissey, P.E. No. 6470 (Ohio).

DESCRIPTION – PARCEL No. 2

Being a parcel of land situate in the west half of the Southeast quarter of Section 20, T-4-S, R-5-E, Logan Township, Auglaize County, Ohio and more particularly described as follows:

Commencing at a one inch iron pin found in a monument box found at the southwest corner of said Southeast quarter of said Section 20; thence N 00°56'30" E with the west line of said Southeast quarter, 440.00 feet to a capped 5/8 inch rebar set and the **PLACE OF BEGINNING** thence continuing N 00°56'30" E with the west line of said Southeast quarter, 1,320.62 feet to a railroad spike previously found at the intersection of said west line with the centerline of Kossuth-Amanda Road; thence N 66°56'43" E with said centerline of said Kossuth-Amanda Road, 1,448.68 feet to a PK nail and shiner set during a previous survey at the intersection of said centerline with the east line of the west half of said Southeast quarter; thence S 00°53'12" W with said east line, 2,353.09 feet to a PK nail and shiner previously set on the south line of said Southeast quarter; thence N 88°54'53" W with said south line (also the centerline of Burnfield Road), 1,100.75 feet to a PK nail and shiner set; thence N 00°56'30" E (passing through a capped 5/8 inch rebar set at 25.00 feet), 440.00 feet to a capped 5/8 inch rebar set; thence N 88°54'53" W, 225.00 feet to the **PLACE OF BEGINNING** containing 60.281 acres more or less and subject to all highway and other legal easements of record. 37.974 acres are in the southwest quarter of said Southeast quarter of Section 20 and 22.307 acres are in the northwest quarter of said Southeast quarter. Road right-of-way occupies 0.505 acre. Deed reference: D.V. 263, Pg. 918.

Surveyed by: **KUCK and MORRISEY, LLC.**, Richard D. Morrissey, P.E. No. 6470 (Ohio).



Signature by a representative of the County Health Dept. denotes compliance with Health Regulations.
Signed: _____ Date _____

Signature by a representative of the Auglaize County Regional Planning Commission denotes approval of this plat.
Signed: _____ Date _____

Signature by a representative of City with 3 mile limit jurisdiction or Twp. Trustees or Village with zoning jurisdiction denotes approval of this plat. Signed: _____
for political S. D. of: _____ Date _____

Signature by a representative of the County Engineer's Dept. denotes that this plat meets tax map plat requirements.
Signed: _____ Date _____

KUCK and MORRISEY, LLC

CONSULTING ENGINEERS & SURVEYORS

LIMA, OHIO 45805

TELEPHONE & FAX 419-228-1735

2807 CHAPEL HILL DRIVE

Client Mary WILKINS
County Auglaize Twp. Logan Sec. 20
Drawn by JRDM Scale 1"=40' Drwg. No. _____
Checked by rdm Date 10/24/15
Sheet 2 of 4
(T-4-S; R-5-E)