


Survey of Parcel #G21-018-008-02 and being a part of the NW 1/4 of Section 18,
Town 5 South, Range 5 East, Moulton Township, Auglaize County, Ohio.
(Deed Referenced in O.R. 727, Pg. 4193)

This plat is recorded in Survey Book "V", Page 265, in the Auglaize County Engineer's Office.

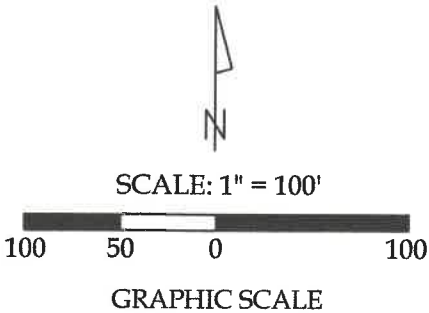

Legend

- A = Existing Monument Box at the NW corner of Section 18
- B = Existing Monument Box at the SW corner of Section 18
- C = Existing PK Nail
- D = Existing RR Spike
- E = Existing #5 Rebar
- F = Set Mag Spike
- G = Set #5 Rebar
- H = Set Mag Nail


Line Data

L - 1 = N 01°-02'-32" E ~ 210.20' (R & M)



This plat represents an actual boundary survey completed under my direct supervision on June 14, 2024.


Kyle J. Binkley, P.S. #8587



24 W. Auglaize Street
Wapakoneta, Ohio 45895
(419) 236-3768

CLIENT: Daniel & Adel Keller			
SURVEYED BY: T.J.S./M.A.B.	DATE: 06-14-2024	DRAWN BY: K.J.B.	CHECKED BY: K.J.B.
SCALE: 1" = 100'		PAGE 1	OF 1

Curve Data

- (C - 1)

Radius = 286.48'

Arc Length = 181.19'

Chord Distance = 178.18'

Chord Bearing = N 65°-01'-25" E
- (C - 2)

Radius = 229.18'

Arc Length = 234.01'

Chord Distance = 223.84'

Chord Bearing = N 76°-10'-36" E

NOTE : All distances on this plat are measured unless otherwise noted.

BASIS OF BEARINGS : The system of bearings for this plat and legal description is based on the Ohio State Plane - North Coordinate System NAD83 (2011).

Surveyor's Note : The centerline for Lock 14 Road was re-established utilizing physical monumentation and survey E-20 of Record in the Auglaize County Tax Map Office.

